

Model Identification/Ignition/Electrical Systems

Honda Model Number Identification							
	Manufacturer	Horse- power	Model Year	Shaft Length	Steering System	Market	
BF2	BF = Honda	EX: 2	DX = 1999 DY = 2000 D1 = 2001 D2 = 2002 D3 = 2003 D4 = 2004 D5 = 2005 D6 = 2006 DK0 = 2007-up	S = 15" L = 20"	H = Throttle Grip C = Centrifugal Clutch	A = American	

EXAMPLE: BF2D1SCHA = Honda, 2 HP, 2001 Model, 15", Centrifugal Clutch w/Throttle Grip, American

DEE	Manufacturer		Horse- power	Model Year	Shaft Length	Steering System	Starter	Market
BF5- BF20	BF = Honda	P = High Thrust Propeller = Standard Propeller	EX: 5 20	D1 = 2001 D2 = 2002 D3 = 2003 D4 = 2004 D5 = 2005 D6 = 2006 DK0 = 2007-up	S = 15" L = 20" XL = 25"	H = Throttle Grip C = Centrifugal Clutch	S = Electric = Manual T = Electric w/ Power Tilt	A = American

EXAMPLE: BFP5D1LHSA = Honda, High Thrust Prop., 5 HP, 2001 Model, 20", Throttle Grip, Elec. Start, American

	Manufacturer	Horse- power	Model Year	Shaft Length	Steering System	Tilt & Trim	Market
BF25- BF225	BF = Honda	EX: 25 115 225	AX = 1999 AY = 2000 A1 = 2001 A2 = 2002 A3 = 2003 A4 = 2005 A6 = 2005 K0 = 2007-up	S = 15" L = 20" X = 25" XX = 30"	R = Remote Control H = Tiller Handle	T = Tilt & Trim = Manual Tilt J = Jet Drive	A = American

EXAMPLE: BF25A1LRTA = Honda, 25 HP, 2001 Model, 20", Remote Control, Tilt & Trim, American

NOTE: After the 2006 model year Honda Marine dropped specific year designations. PKG. OF 10



18-5225 **SPARK PLUG WIRE KIT**

Kit includes 25 ft. Roll of 7 MM Hypalon Ignition Wire With a Metallic Core and a Large Assortment of Three Different End Fittings to Fit Outboard Motors.



18-5226 **IGNITION WIRE Metallic Core** 100' Spool 7mm Hypalon



18-5224 18-5224-9① **SPARK PLUG WIRE TERMINAL**



18-5750 18-5750-9^① **UNIVERSAL SPARK PLUG BOOTS** Supplied complete with **Terminal Connector**

PKG. OF 10



18-5752 **UNIVERSAL SPARK PLUG BOOT** (8mm)



Replaces: 36120-ZV5-822 Fits: 40,50 H.P. (2002-03)



18-6258 **TILT/TRIM MOTOR**

Replaces: 36120-ZV5-821 Fits:BF35,BF40,BF45,BF50 (1992-Up)



18-6433 **OUTBOARD STARTER**

Replaces: 31200-ZV5-013 Fits:40 H.P. (1999-UP)

HONDA Fuel System



FUEL WATER SEPARATORS







Sierra offers a complete line of 10 and 21 micron fuel water separating filters including drainable bowl filters to protect your carbureted and fuel injected engine.

Refer to pages 69-75 for a complete listing of **OEM** and universal applications.

Sierra fuel water separators remove over 99.8% of emulsified water from your gasoline. Sierra's 10 micron filters are over 90% efficient at removing particles as small as 10 micron. All filters flow @ 90 GPH to feed even the hungriest motor. Sierra 10 micron filters are recommended to prevent damage to sensitive inboard and outboard fuel injection systems.

Sierra #	Honda #	Description
18-7947	17670-ZW1-030GH	Spin on Replacement Filter
18-7948	17670-ZW1-801AH	Spin on Replacement Filter
18-8225	16910-GB2-005	Fuel Filter
18-8226	16910-ZV4-015	Fuel Filter
18-7720	16900-SR3-004	Fuel Filter
18-7786	16900-SA5-004	Fuel Filter Kit
18-7785	16010-ST5-993	Fuel Filter Kit



18-7657 **OXYGEN SENSOR** Replaces: 35655-ZY3-013



OXYGEN SENSOR Replaces: 35655-ZY9-003



9' LENGTH COMPLETE FUEL LINE ASSEMBLIES 18-81042EP SILVERADO 3000 Premium OE# 17700-ZW9-010 **FUEL LINE ASSEMBLY** 17700-ZW9-020





18-80401 **FUEL** CONNECTOR 18-8005 **PRIMER BULB**

18-80403-1 **FUEL** CONNECTOR



FUEL LINE ASSEMBLY COMPONENTS

Honda Fuel Application: 8, 9.9, 15, 25, 30, 40, 50, 75, 90, 115, 130 HP (2001-02)



HONDA Fuel/Cooling Systems



18-8005 18-8005-10① PRIMER BULB 3/8"

Replaces: 174512 Large capacity bulb



18-80400 TANK CONNECTOR

Replaces: 16977-ZV5-A00

Male tank outlet, new style, 1/4"NPT, nickel plated brass. Male connector, for fuel tank. **Mates with 18-80401**



Display

18-80401 FUEL CONNECTOR

Female hose connector, new style, 3/8" hose, Will not interchange with OE's 5/16" hose assemblies.

Mates with 18-80400, tank outlet



18-80403-1 FUEL CONNECTOR

Female 3/8 hose connector with rectangular locking post, Will not interchange with OE's 5/16" hose assemblies. For late model engine: For use with our 18-81042 fuel hose assembly, motor end.

Mates with 18-80407



18-80406 FUEL CONNECTOR

Replaces: 16977-ZV5-900 Male tank outlet, old style, 1/4" NPT.



18-80408 FUEL CONNECTOR

Replaces: 17650-ZW9-003 Female 5/16" connector with rectangular locking post. Fits late model engines Mates with 18-80407



18-80420 FUEL CONNECTOR

Replaces:17650-921-003ZB Fits: BF5/BF8A 2001 and earlier Mates with 17710-881-00ZA



FUEL CONNECTOR Replaces: 17710-ZW9-033

5/16 with interlocking post Fits: BF8-BF130 (2003) Mates with 18-80403, 18-80408



18-3031 IMPELLER

Replaces: 19210-ZY3-003 Fits:BF200 & BF225 (2002 & Up)



18-3100 IMPELLER

Replaces: 19210-ZW9-013, 19210-ZW9-003 Fits:BF8D/9.9D short, long shaft



18-3056 18-3056-10① IMPELLER

Replaces: 19210-ZW1-003 For: 75-90 HP



18-3245 IMPELLER

Replaces: 19210-881-A01, 19210-881-A02



18-3246 IMPELLER

Replaces: 19210-ZV4-013 For: BF9.9, BF15, AH, AK, AM, AW Series # 14ZV40M



18-3247 IMPELLER

Replaces: 19210-ZV4-651 For: 8, 9.9, 15 HP



18-3248 IMPELLER

Replaces: 19210-ZV5-003 For: 35, 40, 45, 50 HP



18-3249 IMPELLER

Replaces: 19210-ZV7-003 For: 20, 25, 30 HP



18-3250 IMPELLER

Replaces: 19210-ZW1-B04 For: 75, 90, 115, 130 HP

HONDA Cooling System





IMPELLER PLATE Replaces: 19231-ZW1-003 For: 75-90 HP



18-3268 **IMPELLER KEY** Replaces: 90752-ZV4-650 Fits: BF9.9A, BF15A



18-3269 **IMPELLER KEY** Replaces: 90752-ZV7-000 Fits: BF25, BF30



18-3270 **IMPELLER KEY** Replaces: 90752-ZV5-003 Fits: BF35, BF40, BF45, BF50



IMPELLER KEY Replaces: 90752-ZW1-B02 Fits: BF75-BF90 AX & Up, BF115, BF130

18-3271



18-3273 **IMPELLER KEY** Replaces: 90752-ZY3-003 Fits: BF200, BF225



18-3187 **IMPELLER REPAIR KIT** Replaces: 06192-ZW1-305 Fits:BF75-90, (1996-98)



18-3214 **WATER PUMP KIT** For: BF 70/BF 90 1996-98



18-3278 WATER PUMP SERVICE KIT Replaces: 06192-ZV1-C00 Fits: BF5



WATER PUMP SERVICE KIT Replaces: 06192-881-C00 Fits: BF8A (USA)




18-3280 **WATER PUMP SERVICE KIT** Replaces: 06192-ZV4-000 Fits: BF9.9A/BF15A



18-3281 WATER PUMP SERVICE KIT Replaces: 06192-ZV7-000 Fits: BF25/30



18-3282 WATER PUMP SERVICE KIT Replaces: 06192-ZV5-003 Fits: BF35/45, BF40/50

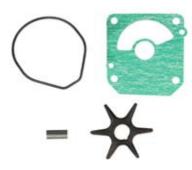

18-3283 WATER PUMP SERVICE KIT Replaces: 06192-ZW1-000 Fits: BF115/130, BF75/90 AX & Later



WATER PUMP SERVICE KIT Replaces: 06192-ZY6-000

Fits: BF135 / BF150

SEE PAGES 117-118 FOR OUR COMPLETE LINE OF GASKET SEALANTS







18-2495 **WATER PUMP GASKET** Replace: 19232-ZV4-610 Fits: BF9.9A, BF15A



18-2496 **WATER PUMP GASKET** Replace: 19233-ZV5-000 Fits: BF25, BF30



18-2499 WATER PUMP GASKET Replace: 19234-ZY3-000 Fits: BF200, BF225









18-2524 WATER PUMP GASKET Replace: 19232-ZV1-A10

Fits: BF5

PKG. OF 2

18-2608 **WATER PUMP GASKET**

Replace: 19232-881-850 Fits: BF8A

PKG. OF 2

M

18-2609 **WATER PUMP GASKET**

PKG. OF 2

Replace: 19234-881-850 Fits: BF8A

18-0176 **WATER PUMP GASKET** Replace: 19242-ZV5-000

PKG. OF 2



18-2563-9①

IMPELLER GASKET

Replaces: 19232-ZW1-003

18-2563



18-2564 **18-2564-9**① **IMPELLER GASKET** Replaces: 19234-ZW1-003



18-2565 18-2565-9^① **IMPELLER GASKET** Replaces: 19242-ZW1-003



18-2945 **18-2945-9**① 18-29451-9^① (PKG. OF 50) **DRAIN SCREW GASKET** Used with 18-2244 Drain Screw





18-0300 **INTAKE MANIFOLD GASKET**

Replaces: 17105-ZY6-000 Fits: BF135-BF150

NEW



18-0390 **INTAKE MANIFOLD GASKET**

Replaces: 17105-ZY3-004 Fits: BF200-BF225 (2002 and UP)



18-0248 **INTAKE MANIFOLD GASKET** Replaces: 17151-ZW5-000



18-0382 THROTTLE BODY **GASKET** Replaces: 17109-ZY6-000

Fits: -BF75-BF150

SEE PAGES 117-118 FOR OUR COMPLETE LINE OF GASKET SEALANTS

HONDA

Cooling/Internal Engine Systems





18-0396 **THROTTLE BODY GASKET**

Replaces: 17109-ZY3-004 Fits: BF200-BF225 (2002 & UP)



18-0737 THROTTLE BODY GASKET Replaces: 16176-P0A-004



18-3288 **SEAL**

Replace: 91252-ZV1-003


Fits: BF5



18-8298 **SEAL**

Replaces: 91252-935-004

Fits: BF8A



18-8299 **MOLDED RUBBER SEAL (O-Ring Material)**

Replace: 91356-ZY3-003 Fits: BF200, BF225



18-1156 **FORWARD GEAR BEARING**

Replaces: 91051-ZW1-003



18-1157 **FORWARD GEAR INNER BEARING**

Replaces: 91057-ZW1-003



18-1158 **CARRIER BEARING**

Replaces: 91053-ZW1-003



18-7909

OIL FILTER Replaces:15400-POH-305PE, 15400-POH-305, 15400-ZJI-004, 15400-PLM-A01PE



18-7911 **OIL FILTER** Replaces:15400-PFB-014



18-7913 **OIL FILTER** Replaces: 15400-PFB-014





18-79111 **OIL FILTER**

Replaces: 15400-PFB-007

							-		
Models	Years	SS Number	Replace	Part #	Models	Years	SS Number	Replace	Part #
BF8D,					BF25	1999-Current	15400-ZW4-003	15400-PFB-007	18-79111
BFP8D	2001-Current	15400-PFB-004	15400-PFB-014	18-7913	BF30	1999-Current	15400-ZW4-003	15400-PFB-007	18-79111
BF9D,					BF40	1999-Current	15400-ZW4-003	15400-PFB-007	18-79111
BFP9D	2001-Current	15400-PM3-004	15400-PFB-014	18-7913	BF50	1999-Current	15400-ZW4-003	15400-PFB-007	18-79111
BF15D,					BF75,				
BFP15D	2003-Current	15400-PM3-405	15400-PFB-014	18-7913	BF90	1997-Current	15400-P0H-305PE	15400-PLM-A01PE	18-7909
BF20D	2003-Current	15400-PJ7-015	15400-PFB-014	18-7913	BF115,	1007 00110111	10.001.000.2	10.00.1 27.0 2	
BF25A	1998-Earlier	15400-PJ7-005	15400-PFB-014	18-7913	BF130	1999-Current	15400-P0H-305	15400-PLM-A01PE	18-7909
BF30A	1998-Earlier	15400-PJ7-005	15400-PFB-014	18-7913		1999-Current	13400-201-303	13400-PLINI-AUTPE	10-7909
BF35AM	1998-Earlier	15400-PJ7-005	15400-PFB-014	18-7913	BF135,				
BF40A	1998-Earlier	15400-PJ7-005	15400-PFB-014	18-7913	BF150	2004-Current	15400-ZJ1-004	15400-PLM-A01PE	18-7909
BF45AM	1998-Earlier	15400-PJ7-005	15400-PFB-014	18-7913	BF200,				
BF50A	1998-Earlier	15400-PJ7-005	15400-PFB-014	18-7913	BF225	2002-Current	15400-ZJ1-999AH	15400-PLM-A01PE	18-7909



Zinc is for saltwater only applications. Magnesium is for fresh water only applications. Aluminum is for brackish water, or if boat is used in both fresh and salt environments.



3 18-6025 ANODE

Replaces: 41107-ZV5-00 For use on extension cases: BF25, BF30, BF35, BF40, BF45, BF50 (1997-Up)



2 18-6241 **3 18-6011** ① 18-6011A

ANODE Replaces: 41107-ZW1-003ZA BF75-BF90 (1997-98)



3 18-6068 ANODE

Replaces: 41109-ZW1-003 BF75-BF90 (1997-98)



18-6504 **REWIND SPRING**

Replaces: 28451-921-000 For: BF 75 (7.5 HP) FF100 (9.9 HP)



18-3200 18-3200-94 **TAB WASHER** Replaces: 90508-ZW1-003

For: 75-90 HP

⑤18-3701D Display 18-3701 **PROP NUT KIT** CONTAINS O.E.#

Part # 18-3200 18-3700 90508-ZW1-003 90301-ZW1-003

Description Tab Washer Prop Nut

PKG. OF 5



18-7198 18-7198-94 **O-RING**

Replaces: 91353-ZW1-003



OIL SEALS			
Part #	Description	O.E. #	
18-0522	Drive Shaft	91254-ZW1-003	
18-0583	Drive Shaft	91251-ZW1-003	
18-2002	Prop Shaft	91252-ZW1-003	
18-2053	Prop Shaft	91255-ZW1-003	
18-2054	Shift Shaft	91253-ZW1-003	




LOWER UNIT SEAL KIT For: Series 14ZV50M



18-8363 **LOWER UNIT SEAL KIT**



LOWER UNIT SEAL KIT



18-8365 LOWER UNIT SEAL KIT



LOWER UNIT SEAL KIT APPLICATION					
HP/Model	Part #				
BF 9.9, BF 15	18-8363				
BF 20	18-8364				
BF 35/45 AM,					
BF 40/50 A, AW, AX	18-8362-1				
BF 75, BF 90	18-8366				
BF115, BF130	18-8365				

- ② Magnesium
- 3 Zinc
- Priced per Package

① Aluminum